

Classification:

BT10-038a

Reference:

ITB10-070a

COPYRIGHT © NISSAN NORTH AMERICA, INC.

Date:

May 16, 2011

2009 - 2011 G37 CONVERTIBLE; WATER LEAK AT WINDSHIELD HEADER AREA

This bulletin has been amended. A Repair Flow Chart has been added. The Title, APPLIED VEHICLES, ACTION, PARTS INFORMATION, CLAIMS INFORMATION, and SERVICE PROCEDURE have been amended. Please discard all previous copies.

APPLIED VEHICLE: 2009 - 2011 G37 Convertible (HV36)

IF YOU CONFIRM

A water leak is coming from the top of the windshield (windshield header area).

ACTION

 Use the **Repair Flow Chart** (on Page 2) to determine which repair to perform.

PARTS INFORMATION

Description	PART #	Quantity
Permatex® Clear RTV Silicone Adhesive Sealant (1)	Permatex® Item # 80050 (2) Local Source	up to 1 container (3)
Flat washer	Local Source	6 (4)

(1) Permatex® Clear RTV Silicone Adhesive Sealant is available at many local auto supply stores.

 (2) The MSDS for this product is available at www.permatex.com.

 (3) Please use **EXPENSE CODE 009** for the amount indicated.

(4) Shop supply.

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Apply Sealer to Windshield Header Weather-strip	76860-JJ50A	BX2NAA	ZQ	53	0.2

AND / OR

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Front Latch repair (Add Shims)	76860-JJ50A	SX04AA	ZQ	53	0.6

EXPENSE CODE	DESCRIPTION	AMOUNT
009	Silicone Sealant	\$5.00*

* Only claim for the amount indicated.

IMPORTANT: The purpose of **ACTION** (above) is to give you a quick idea of the work you will be performing. You **MUST** closely follow the entire **REPAIR FLOW CHART** as it contains information that is essential to successfully completing this repair.


Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti dealer to determine if this applies to your vehicle.

Repair Flow Chart

Verified: Water is leaking from the top of the windshield header area

Leaks from one or both areas circled in **RED**: Perform Procedure A (Page 3)

Leaks from one or both areas circled in **GREEN**: Perform Procedure B (Page 4)

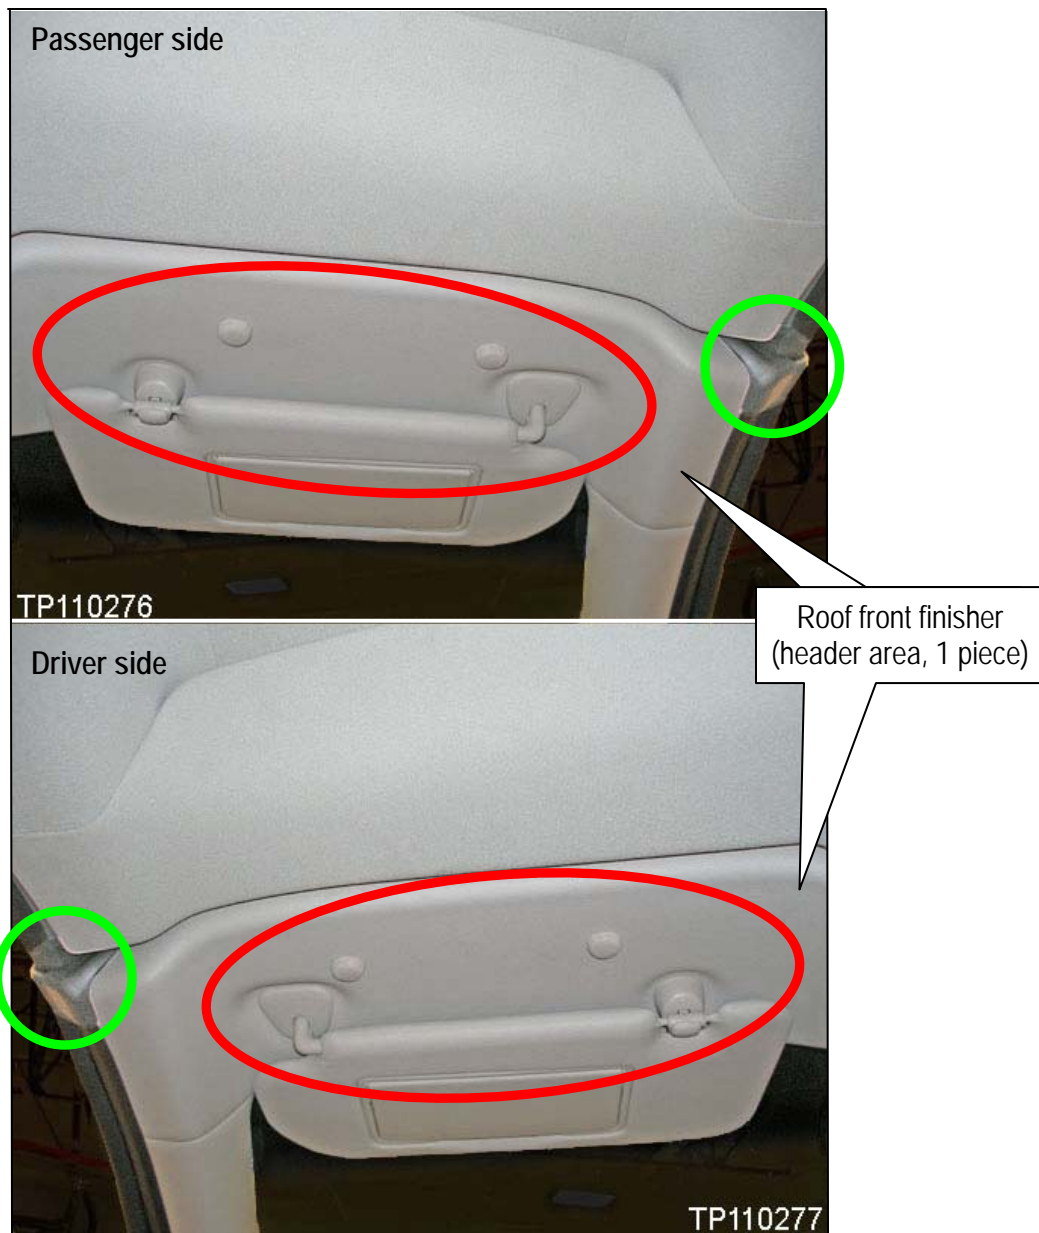

SERVICE PROCEDURE

Procedure A

1. Open the convertible top to the fully open position.
2. Apply silicone sealer along the entire length of the windshield header (see Figure 1 and 2).
 - Use the sealer listed in the Parts Information, or equivalent.
 - Apply the sealer between the edge of the header weather-strip and the header.



Figure 1

- Gently pull the edge of the weather-strip away from the header and squeeze in a small amount of sealer.
- Apply the sealer along the entire length of the header.
- Make sure to clean any excess sealer off of the header and weather-strip.



Figure 2

3. Allow the sealer to cure for at least 3 hours with the top open.

NOTE: Recommended cure time is 24 hours with the top open.

Procedure B

1. Open the convertible top in the fully open position.
2. Remove the roof front finisher.
 - Refer to the Electronic Service Manual (ESM), if needed.
3. Remove both roof latches (see Figure 3 and 4).

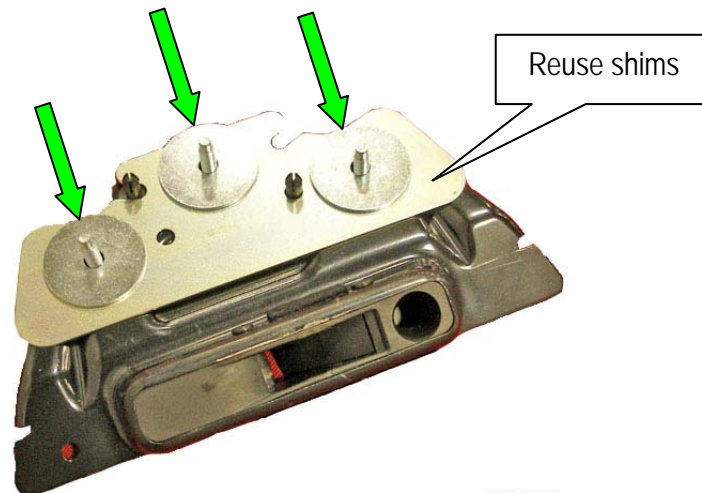


Figure 3



Figure 4

4. Add one (1) flat washer for each of the three (3) bolts per roof latch (as shown below).
 - Do not remove any existing shims.



TP110282

5. Reinstall both roof latches.

6. Completely close the roof: Make sure the front roof panel's leading edge is 1- 2 mm (0.04 - 0.08 inches) below the rear edge of the header (see Figure 5).



Figure 5

6. Reinstall the roof front finisher.

